


Property Owners of Sublots 3, 4, 5 and 6 Shall Be Advised that Jurisdictional Waters of the United States are Located on these Lots. Activities such as Draining and/or Filling the Jurisdictional Areas Which Would Adversely Affect the Jurisdictional Area or The Buffer Area Require Prior Notification to the U.S. Army Corps of Engineers

- LEGEND**
- M 5/8" x 30" Iron Pin Set in Mon. Box (With yellow Plastic Cap "LDC, Inc.") "After Construction"
  - Iron Pin Found (See survey)
  - Iron Pipe Found (See Survey)
  - 5/8" x 30" Iron Pin Set (With yellow Plastic Cap "LDC, Inc.") "After Construction"
- Meas. = Measured                      Dd. = Deed  
 Plat = Subdivision Plat              Rec. = Record  
 D./M. = Deed & Measured            Act. = Actual

CURVE	LENGTH	RADIUS	DELTA	CHORD	CHORD	
					BFG	TANGENT
C1	154.42	1125.20	7°51'48"	154.30	N28°08'53"E	77.33
C2	45.57	30.00	87°01'22"	41.31	N11°25'54"W	28.48
C3	62.04	405.00	8°46'39"	61.98	N50°33'15"W	31.08
C4	100.26	405.00	14°11'00"	100.00	N39°04'26"W	50.39
C5	140.71	405.00	19°54'21"	140.00	N22°01'45"W	71.07
C6	104.92	405.00	14°50'33"	104.62	N04°39'18"W	52.75
C7	340.06	345.00	56°28'34"	326.46	N18°07'07"W	185.28
C8	51.70	345.00	8°35'11"	51.65	N50°38'59"W	25.90
C9	45.57	30.00	87°01'22"	41.31	N81°32'44"E	28.48
C10	202.13	1125.20	10°17'34"	201.86	N43°10'50"E	101.34
C11	253.65	1095.20	13°18'12"	253.09	N41°41'31"E	127.40
C12	197.27	1095.20	10°19'13"	197.00	N29°53'49"E	98.90
C13	450.92	1095.20	23°35'24"	447.74	N36°31'55"E	228.70
C14	260.60	1125.20	13°18'12"	260.02	N41°41'31"E	130.89
C15	212.89	1125.20	10°50'26"	212.58	N29°38'12"E	106.77
C42	90.22	405.00	12°45'50"	90.04	S09°08'54"W	45.30

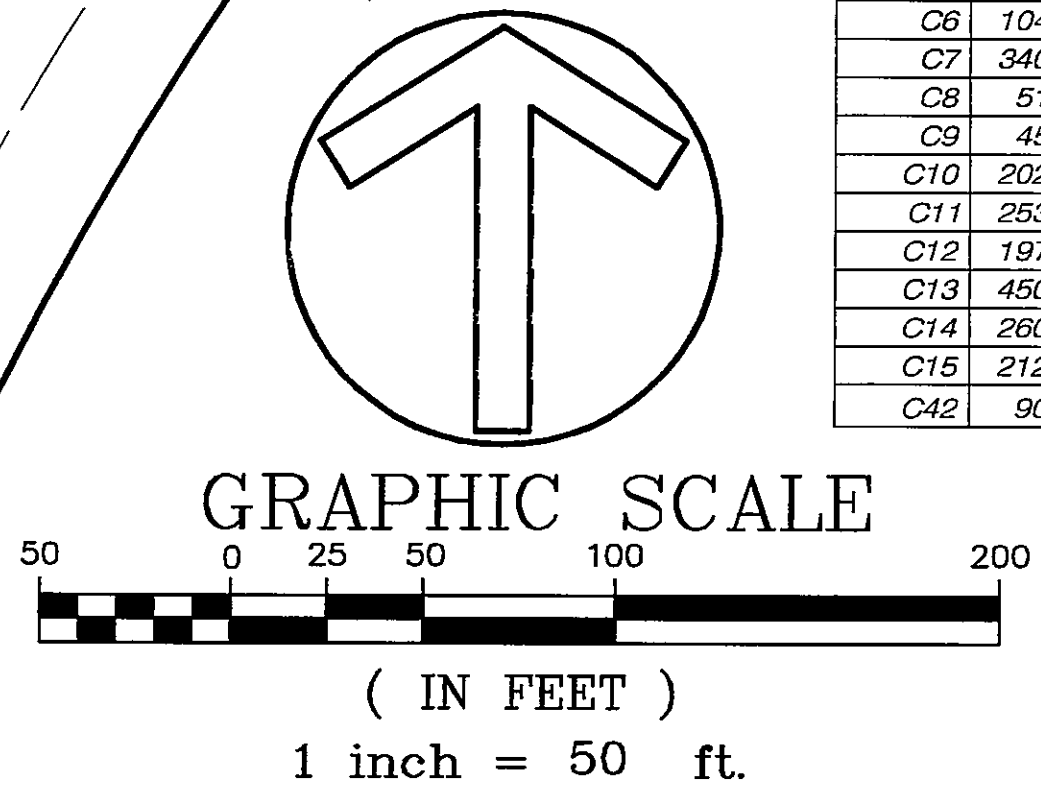

Willis R. Nash  
 Doc. #960004168  
 2-8-96  
 P.P.N. 31A-17-28

Judith C. Moore  
 Doc. #960004167

LDC Inc. o.b.a.

**LAND DESIGN consultants**  
 Civil Engineers and Surveyors  
 8885 EAST AVENUE MENTOR, OHIO 44060  
 TELEPHONE 255-8463 354-6938 951-LAND